


Severn R.

C I BEVH

STANDARDS DEVELOPMENT BRANCH OMSE



36936000009187

REPORT OF WATER QUALITY IN MACLEAN LAKE SIMCOE CO.

1973



Ontario

Ministry
of the
Environment

The Honourable
William G. Newman,
Minister

Everett Biggs,
Deputy Minister

Copyright Provisions and Restrictions on Copying:

This Ontario Ministry of the Environment work is protected by Crown copyright (unless otherwise indicated), which is held by the Queen's Printer for Ontario. It may be reproduced for non-commercial purposes if credit is given and Crown copyright is acknowledged.

It may not be reproduced, in all or in part, for any commercial purpose except under a licence from the Queen's Printer for Ontario.

For information on reproducing Government of Ontario works, please contact ServiceOntario Publications at copyright@ontario.ca

REPORT OF WATER QUALITY - REG. - CANADA ONT - A

in

MACLEAN LAKE

SIMCOE CO.

1973

GENERAL TABLE OF CONTENTS

LIST OF FIGURES.....	ii
PREFACE.....	iii
SUMMARY.....	iv
PURPOSE OF THE SURVEYS.....	1
DESIGN OF THE SURVEYS	
Sampling Locations & Frequency.....	2
Field Tests.....	2
Bacteriological Tests.....	2
Chemical Tests.....	5
DESCRIPTION OF MACLEAN LAKE AREA	
Lake and Soil Characteristics.....	7
Shoreline Development and Water Usage.....	7
RESULTS AND DISCUSSION	
Bacteriology.....	8
Chemistry.....	9
Chlorophyll <u>a</u> and Water Clarity.....	16
Aquatic Plants.....	18
Future Considerations.....	20
TABLE 1	
A List of Aquatic Plants Found in MacLean Lake.....	19
INFORMATION OF GENERAL INTEREST TO COTTAGERS	
Microbiology of Water.....	A-1
Rainfall and Bacteria.....	A-1
Water Treatment.....	A-2
Septic Tank Installations.....	A-3
Dye Testing of Septic Tank Systems.....	A-4
Boating Regulations.....	A-5
Eutrophication or Excessive Fertilization and Lake Processes.....	A-6
Control of Aquatic Plants and Algae.....	A-9
Phosphorus and Detergents.....	A-10
Ontario's Phosphorus Removal Program.....	A-10
Control of Biting Insects.....	A-11

LIST OF FIGURES

Figure 1	Station locations, Lakeshore Development and Major Areas of Shoreline Aquatic Plant Growth	3
Figure 2	Use of Secchi Disc to Determine Water Clarity	4
Figure 3	Distribution of Bacteria During the June Survey	10
Figure 4	Distribution of Bacteria During the August Survey	11
Figure 5	Distribution of Bacteria During the September Survey. . .	12
Figure 6	Dissolved Oxygen and Temperature Profiles at Stations 22 and 23.	13
Figure 7	The Mean of Chlorophyll <u>a</u> and Secchi Disc Measurements in MacLean Lake Relative to a Curve Describing the Chlorophyll <u>a</u> - Secchi Disc Relationship in Many Ontario Lakes	17

PREFACE

The Province of Ontario contains many thousands of beautiful small inland lakes which are most attractive for recreational use. Lakes close to urban areas and accessible by road often receive heavy use in terms of cottage development, camp sites, trailer parks and picnic areas.

A heavy influx of people may subject a lake and its surrounding environment to great stress. In some cases, developments are carried out on attractive lakes only to find that when this is complete the lake qualities which were initially so appealing have been damaged. The appearance of the shoreline can be marred by construction, fishing ruined by over-harvesting or by the growth and decay of excessive amounts of algae and weeds. Motor boats introduce noise and petroleum pollution. Inadequate disposal of human wastes can place a great stress on the lake environment.

The accepted custom of having "a place at the lake" continues to apply pressure for more development, giving rise to an even greater expansion of problems.

The Ontario Ministry of the Environment is attempting to bring some of these stress factors under control with a variety of programs. The cottage pollution control program was initiated in 1967 and was expanded in 1970 in order to solve the cottage waste disposal problem in recreational lakes. There are three ongoing studies carried out by the Ministry:

1. Evaluation of existing waste disposal systems and enforcement of repairs to those found to be unsatisfactory;
2. Research to improve the knowledge of septic tank operation and effects in shallow soil areas and evaluation of alternative methods of private waste disposal;
3. Evaluation of present water quality in a number of recreational lakes. A totally undeveloped lake near Huntsville was studied in 1972 and 1973 in order to obtain more information about natural water quality conditions within a Precambrian Lake, which would assist in defining any unnatural conditions encountered in the

developed lakes surveyed.

This report on MacLean Lake is one of a series dealing with the water quality aspects of the recreational lakes studied in 1973. As well as defining present status of water quality in the lakes, the data are meant to provide an historical reference for comparison of conditions at any future time.

SUMMARY

In 1973, surveys were carried out in MacLean Lake in June, August and September, to evaluate the present status of the water quality by measuring chemical, biological and bacteriological parameters.

MacLean Lake is located in Simcoe County and lies within the Precambrian Shield. The immediate surroundings are characterized by areas of poorly drained clay, coarse and fine sands and rocky outcrops, while the shoreline is moderately to steeply sloping and generally very rocky.

MacLean Lake had good bacteriological water quality during the August and September surveys and was within the Ministry of the Environment Microbiological Criteria for Recreational Use. Most of the lake exceeded the Recreational Use Criteria for total coliform bacteria in the June survey but was not accompanied by correspondingly high fecal coliform densities. The mouth of a small creek in a northern bay (Station 24) consistently exceeded the Ministry criteria for enterococcus and total coliforms during all three surveys. However, the creek drained a marsh area, and fecal coliform densities were not correspondingly high, so this contamination was thought to be of non-human origin. Two other small creeks, Stations 1, 25, were similarly contaminated.

MacLean Lake is a soft water lake, having relatively low mineral concentrations but very high nutrient and iron levels. Severe oxygen depletions occurred in the bottom waters during the summer and early fall surveys rendering these depths unsuitable for fish and causing substantial regeneration of nutrients and iron. Suspended algal concentrations were extremely high during the fall survey, and adversely affected the recreational use of the lake. The water clarity was poor, as indicated by low Secchi disc readings.

PURPOSE OF THE SURVEYS

As a result of human activity in the recreational lake environment, some wastes may reach the lake itself and this can lead to either or both of two major types of water quality impairment: microbial contamination and excessive growths of algae and aquatic plants. While the two problems can result from a common source of pollution, the consequences of each are quite different.

Microbial contamination by raw or inadequately treated sewage does not significantly change the appearance of the water but poses an immediate public health hazard when the water is used for drinking or swimming. This type of pollution can be remedied by preventing wastes from reaching a lake. If this is the only source of pollution, satisfactory water quality will then return since disease causing bacteria do not usually persist in lake water.

Problems due to nutrient enrichment may be long lasting even if further excess nutrients are prevented from entering the lake. Nutrient enrichment, or eutrophication, results from the addition of plant fertilizers which occur naturally and which are also present in virtually all forms of raw or treated human wastes. High concentrations of these fertilizers (plant nutrients), mainly nitrogen and phosphorus, can support excessive growths of rooted aquatic plants and of microscopic free-floating plants called algae. While aquatic weed beds provide shelter, and both algae and rooted plants provide food for many kinds of fish, excessive growths of either are undesirable since they can upset the oxygen balance in the lake, interfere with recreational uses, and greatly affect the lake's appearance. They do not, however, generally pose a health hazard.

In order to detect either of these conditions, the surveys were designed and tests selected to evaluate the current condition of the lake with respect to:

- lakeshore development
- the distribution and abundance of bacteria
- changes in temperature, dissolved oxygen and water quality with depth
- plant nutrients and suspended algae
- densities and species of aquatic plants

DESIGN OF THE SURVEYS

Sampling Locations and Frequency

A proper estimate of the bacterial population requires several measurements of bacterial densities over a period of time which can then be averaged as a geometric mean. Measurements over 5 consecutive days at each station are regarded as the minimum number which when taken at many lake stations, will give reliable bacteriological results.

Five day bacteriological, chemical and biological surveys were carried out from June 5 to 16, from August 17 to 27 and from September 20 to 24. Additional results from samplings carried out between July and November by staff not directly associated with the Recreational Lakes Programme have been incorporated into the present report.

Samples for bacterial analysis were taken daily one meter below the surface at 26 stations established throughout the lake, as well as from one meter above the bottom at two mid-lake stations (Figure 1).

Chemical samples were taken through the illuminated layer of surface water and from one meter above bottom at each mid-lake station, but at the inlet and outlet stations, were collected one meter below the surface. During the five day spring and summer surveys chemical samples were obtained on the first and fifth day. Through the three day fall survey they were collected each day. Separate samples for chlorophyll analysis were collected daily through the illuminated surface water at the mid-lake and inlet stations.

Aquatic plant samples were obtained from areas representative of sparse, medium and dense growth.


Field Tests

The variations in temperature and dissolved oxygen values with depth were measured at the two deep water stations with an electronic probe lowered into the lake and water clarity was measured with a Secchi disc (Figure 2). The pH of the samples was also measured in the field.

Bacteriological Tests

The numbers of bacteria in each of three types of "indicator" organisms were determined on each sample. The three bacterial types, total coliform, fecal

FIGURE 1 - STATION LOCATIONS, LAKESHORE DEVELOPMENT AND MAJOR AREAS OF SHORELINE AQUATIC PLANT GROWTH OF MACLEAN LAKE

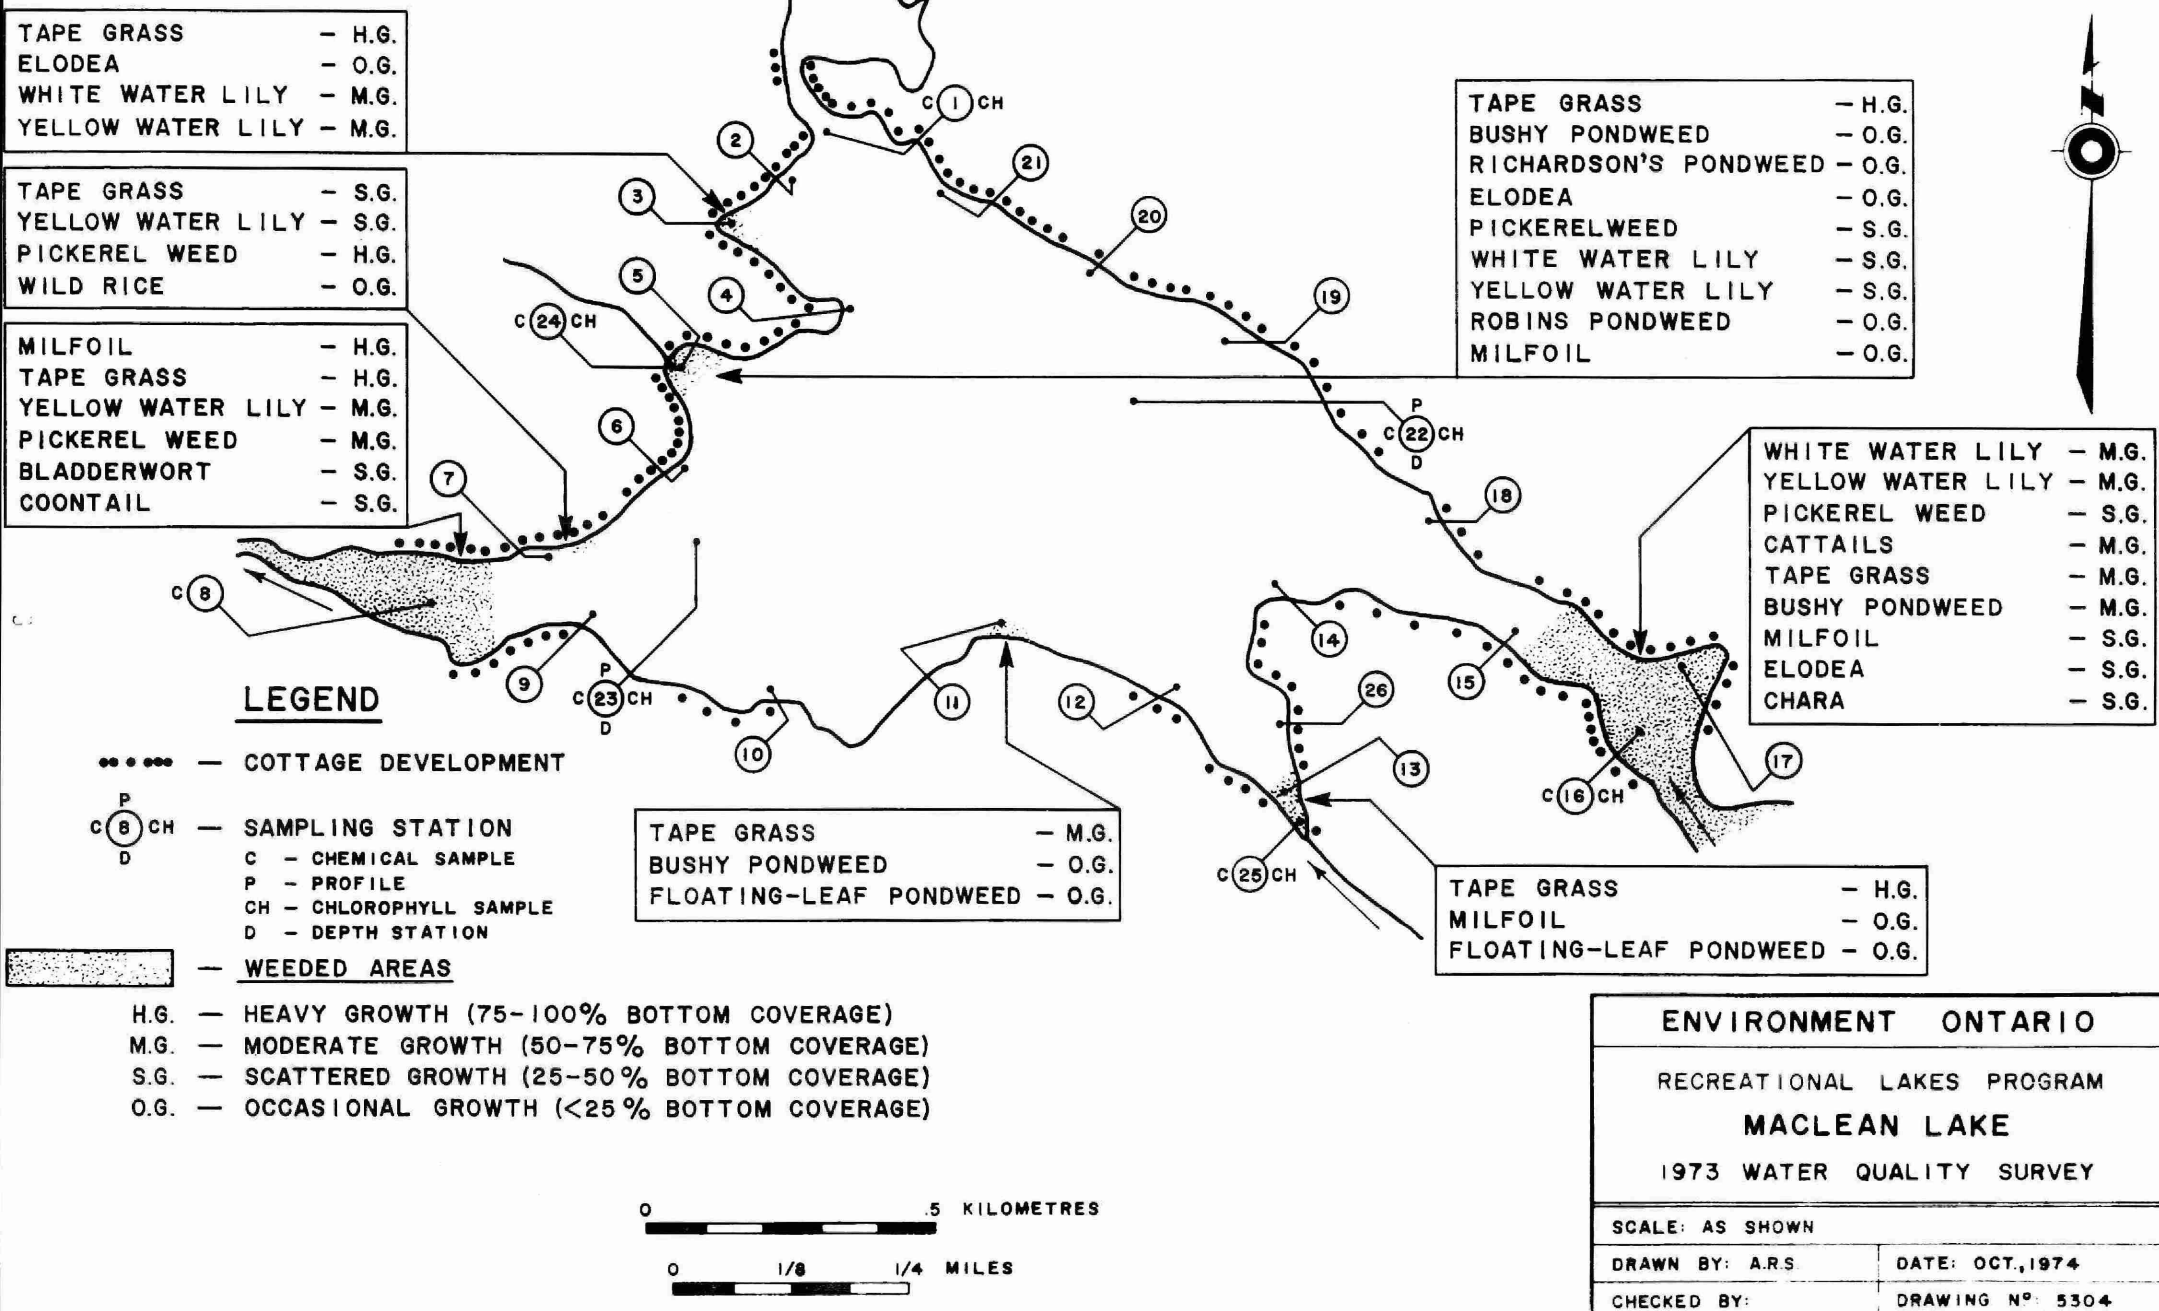

The "Secchi Disc Reading" is obtained by averaging the depth at which a 23cm (9") dia. black and white plate, lowered into the lake just disappears from view and the depth where it reappears as it is pulled up.

Most of the free-floating algae are suspended in the illuminated region between the lake surface and 2 times the Secchi disc reading.

Clear, algae-free lake:
Secchi disc readings tend to be greater than 3m (9 feet).

Turbid or algae-rich lake:
Secchi disc readings tend to be less than 3m (9 feet).

Secchi Disc Reading

2 times Secchi disc reading

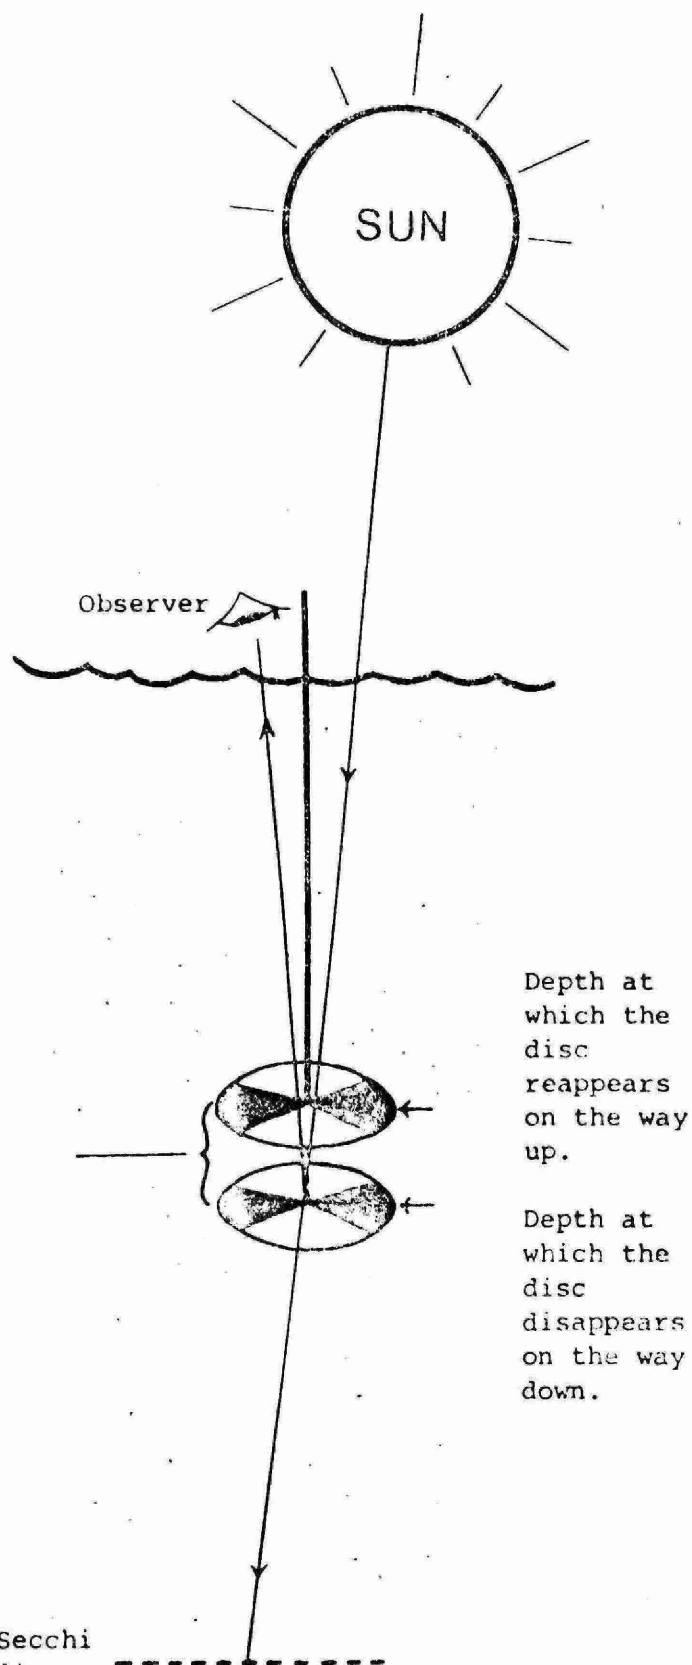


FIGURE 2: USE OF THE SECCHI DISC TO DETERMINE WATER CLARITY.

and enterococcus (fecal streptococcus) bacteria are all indigenous to man and other warm blooded animals, and are found in the colon and feces in tremendous numbers. Many diseases common to man can be transmitted by feces, consequently, the probability of occurrence of these diseases is usually highest in areas where the water is contaminated. These indicator organisms in water connote the possible presence of disease causing organisms.

The density (numbers per 100 ml) of the indicator bacteria in water will vary considerably between pairs of samples taken at the same station, or at different stations on a lake, or if taken at different times, and so the assessment of water quality cannot be determined accurately from a single water sample.¹ Therefore the bacteriological surveys require many samples to be taken at several lake stations over a period of time, and following this the large amount of data so obtained is reduced by calculation to meaningful and easily manipulated statistics.

This data was then evaluated by statistical techniques in the following manner. The geometric mean,¹ (the most appropriate central value) and standard deviation were calculated for the values of each bacterial type at every station, providing concise valid data. Statistically significant variations in the bacterial densities between stations, or groups of stations, were determined by selected statistical techniques². By these means the data from each station were tested against that of every other station until all stations with similar geometric mean densities were separated into groups (Group A, B---).

The group results, and those for individual stations, were then displayed on a map of the lake with each group identified by different stippling. Within each stippled area the group geometric mean applied for each type of bacteria, unless otherwise indicated by individual station values. The areas of better or worse bacterial quality were defined by the group geometric mean densities, and so any inputs of bacterial contamination, and the areas they affect, were readily identified.

Chemical Tests

Hardness, alkalinity, chloride, iron and conductivity were measured in order to define the mineral composition of the water. The types of plants

¹Guidelines and Criteria for Water Quality Management in Ontario MOE 1973.

²An Analysis of Variance and Bartlett's Test of Homogeneity.

and animals which thrive, effects of toxic materials and suitability of the lake for various management techniques are affected by the mineral content.

Total and soluble phosphorus were measured in the inlet and bottom water samples while total phosphorus only was measured in the mid-lake and outlet surface samples. Soluble phosphorus concentrations are used mainly to substantiate various interpretations of the total phosphorus concentrations.

The total Kjeldahl nitrogen is (apart from ammonia nitrogen) essentially the amount of nitrogen contained in organic material. It was measured in all of the chemical samples. The soluble forms of nitrogen (ammonia, nitrite and nitrate) were measured in the inlet and bottom water samples. They are particularly important in bottom waters since nitrogen may be regenerated from decaying organic matter in these forms.

Chlorophyll a concentrations are an indication of the amount of suspended algae in the water. The live algae are confined mainly to the illuminated surface water which extend down to a depth of about twice the Secchi disc reading. The chlorophyll samples were collected by filling the sample bottle as it was lowered and raised through the depth of the illuminated surface waters. The sample was then representative of the algal density through the sampling depth.

DESCRIPTION OF MACLEAN LAKE AREA

Lake and Soil Characteristics

MacLean Lake lies within the Precambrian Shield approximately 4 kilometers (2.5 miles) northeast of Port Severn in Matchedash Township, Simcoe County. The lake is about 2.5 kilometers (1.6 miles) long, with a water surface area of 1 square kilometer (240 acres) contained by 8.3 kilometers (5.2 miles) of shoreline. The lake has a mean depth of 5.2 meters (17.1 feet) and a maximum depth of 10.8 meters (35 feet) according to available information from the Ministry of Natural Resources.

MacLean Lake is located in the Severn River Drainage Basin, with the lake's drainage basin comprising an area of 120 square kilometers (29,750 acres). There is one outflow, which is considered part of the Severn River, located at the west end of the lake. There are two major inflows, one draining a marsh at the northwest end of the lake, and the other coming from both Otter Lake and the Matchedash River at the southeast end of the lake.

The area surrounding most of the lake is of the Rock-Atherley clay complex, which is made up wholly of rock outcrop and poorly-drained Atherley clay. However, the soils of the north shore of MacLean Lake are of the Tioga Series, which consist of well-drained calcareous outwash sand. The shoreline is moderately to steeply sloping and is generally very rocky.

Shoreline Development and Water Usage

There are approximately 150 cottages on MacLean Lake (Figure 1). The lake is heavily developed, with the exception of a relatively large undeveloped area along the southwest shoreline. The lake is serviced by one marina and a government dock at the west end of the lake.

Recreational uses of the lake include boating and angling. Due to excessive growths of suspended algae and turbid, coloured water, other recreational activities such as swimming are restricted. According to information from the Ministry of Natural Resources, the common game fish are smallmouth bass, northern pike and walleye.

A survey of the private sewage disposal systems on MacLean Lake was undertaken by the Private Waste and Water Management Branch of the Ministry during the summer of 1973. The results of this survey indicated that over 50% of the systems were substandard. The Simcoe County Health Unit will be undertaking an abatement program based on the above survey, which should ultimately ensure correction of substandard systems.

RESULTS AND DISCUSSION

Bacteriology

The data for the August and September surveys showed that the overall bacteriological water quality of MacLean Lake in 1973 was good and well within the Ministry of the Environment Microbiological Criteria for Total Body Contact Recreational Use, which states:

"Where ingestion is probable, recreational waters can be considered impaired when the coliform (TC), fecal coliform (FC) and/or enterococcus (fecal streptococcus, FS) geometric mean density exceeds 1000, 100 and/or 20 per 100 ml respectively, in a series of at least ten samples per month, --- (1)".

The June survey however, indicated that total coliform densities exceeded the criteria for most of the lake, but were not accompanied by corresponding increases in the levels of fecal coliform and enterococcus bacteria. At this time, the main body of MacLean Lake (Group A; Figure 3) had a high geometric mean of 1,520 TC/100 ml, while the combined inflow from Otter Lake and the Matchedash River (Group B), contained only 167 TC/100 ml (Figure 3). Fecal coliforms and fecal streptococcus levels were 1 FC/100 ml and 3 FS/100 ml, except at Stations 24 and 25. The small inflow in a bay in the southern portion of MacLean Lake (Station 25) had geometric means of 6,240 TC, 2 FC and 46 FS/100 ml, and the mouth of a small creek in the northwest bay (Station 24) draining a marsh area had a high bacterial level of 1,520 TC, 3 FC and 109 FS/100 ml. Since both of these inflows had only marginally higher fecal coliform levels than were encountered on the rest of the lake, the source of these bacterial inputs is not likely human in origin because of the relatively high fecal streptococcus densities.

The overall bacteriological water quality of MacLean Lake in August was much improved over that of the immediate June survey. The overall geometric mean for total coliforms had dropped substantially to 41 TC/100 ml (Group A; Figure 4). The fecal coliform geometric mean for the lake was 2 FC/100 ml except for the area within the influence of the Matchedash River (Group C) which was 5 FC/100 ml and an intermediate area (Group B), with 1 FC/100 ml (Figure 4). An inflow in the extreme northerly bay (Station 1) proved to be a minor pollution source with 9 FC and 6 FS/100 ml. The small creek in the northwest bay (Station 24) during August had exceptionally high levels of TC and FS, which were in excess of the Recreational criteria, with geometric means of 5,820 TC and 404 FS/100 ml. The highest fecal coliform levels were also encountered at Station 24 with a mean of 66 FC/100 ml which approached the Recreational criteria.

(1) Guidelines and Criteria for Water Quality Management in Ontario. MOE 1973.

The overall geometric mean for total coliforms was slightly lower (23 TC/100 ml; Figure 5) in September than in August. The only exception noted was the inflow of the small creek in the northwest bay (Station 24) which again had an extremely high geometric mean of 4,020 TC/100 ml. The fecal coliform density for the main body of MacLean Lake in the fall was homogeneous at 1 FC/100 ml. The inflow in the extreme northerly bay (Station 1) had a mean of 6 FC/100 ml, while both a small creek (Station 24), and a cottaged area in the south bay (Station 15), within the influence of the Matchedash River, had means of 4 FC/100 ml.

The overall geometric mean for enterococcus in September was 3 FS/100 ml. Two exceptions were the inflow in the extreme north (Station 1), and the small creek in the northwest bay (Station 24) which both exceeded the criteria with means of 30 FS and 826 FS/100 ml respectively. Furthermore the bay (Station 5) influenced by this small creek (Station 24) had high enterococcus levels of 170 FS/100 ml, which exceeded the Recreational criteria.

The bacteriological water quality of MacLean Lake exceeded the criteria for total coliforms during the June survey, but it was found to be much improved in the two subsequent surveys. Over the three surveys, recurrent, high bacterial levels were found in three small input streams (Stations 1, 24, 25). The low fecal coliform levels relative to the enterococcus levels indicated however, that the source of the bacterial inputs was likely non-human in origin at these stations (i.e. natural soil bacteria and/or animal contamination).

Chemistry

A zone of rapid temperature decline (thermocline) was observed at both deep-water stations in MacLean Lake during the spring and summer surveys. During the fall survey, due to the mixing action of the wind, Station 23 had homothermal (uniform temperature) conditions while Station 22 was nearly homothermal, having a thermocline only in the last 2 meters above bottom (Figure 6). Later fall sampling indicated that the lake completely "turned over" by mid-October (see Page A-6 for explanation).

By the August survey, severe oxygen depletions had occurred in the bottom waters of MacLean Lake, with the waters at the 5 meter depth and below void of dissolved oxygen until the lake mixed in the fall (Figure 6). Even during the later part of the June survey, low dissolved oxygen concentrations were evident in the bottom 3 meters of Station 22, averaging less than 30% saturation, and were as low as 8% saturation at 1 meter off bottom. These dissolved oxygen depletions are caused by biochemical oxidation and bacterial decomposition of organic material, especially algae (see page A-6). Fish and fish food organisms will not survive at such low oxygen concentrations.

FIGURE 3 - DISTRIBUTION OF BACTERIA DURING THE JUNE SURVEY



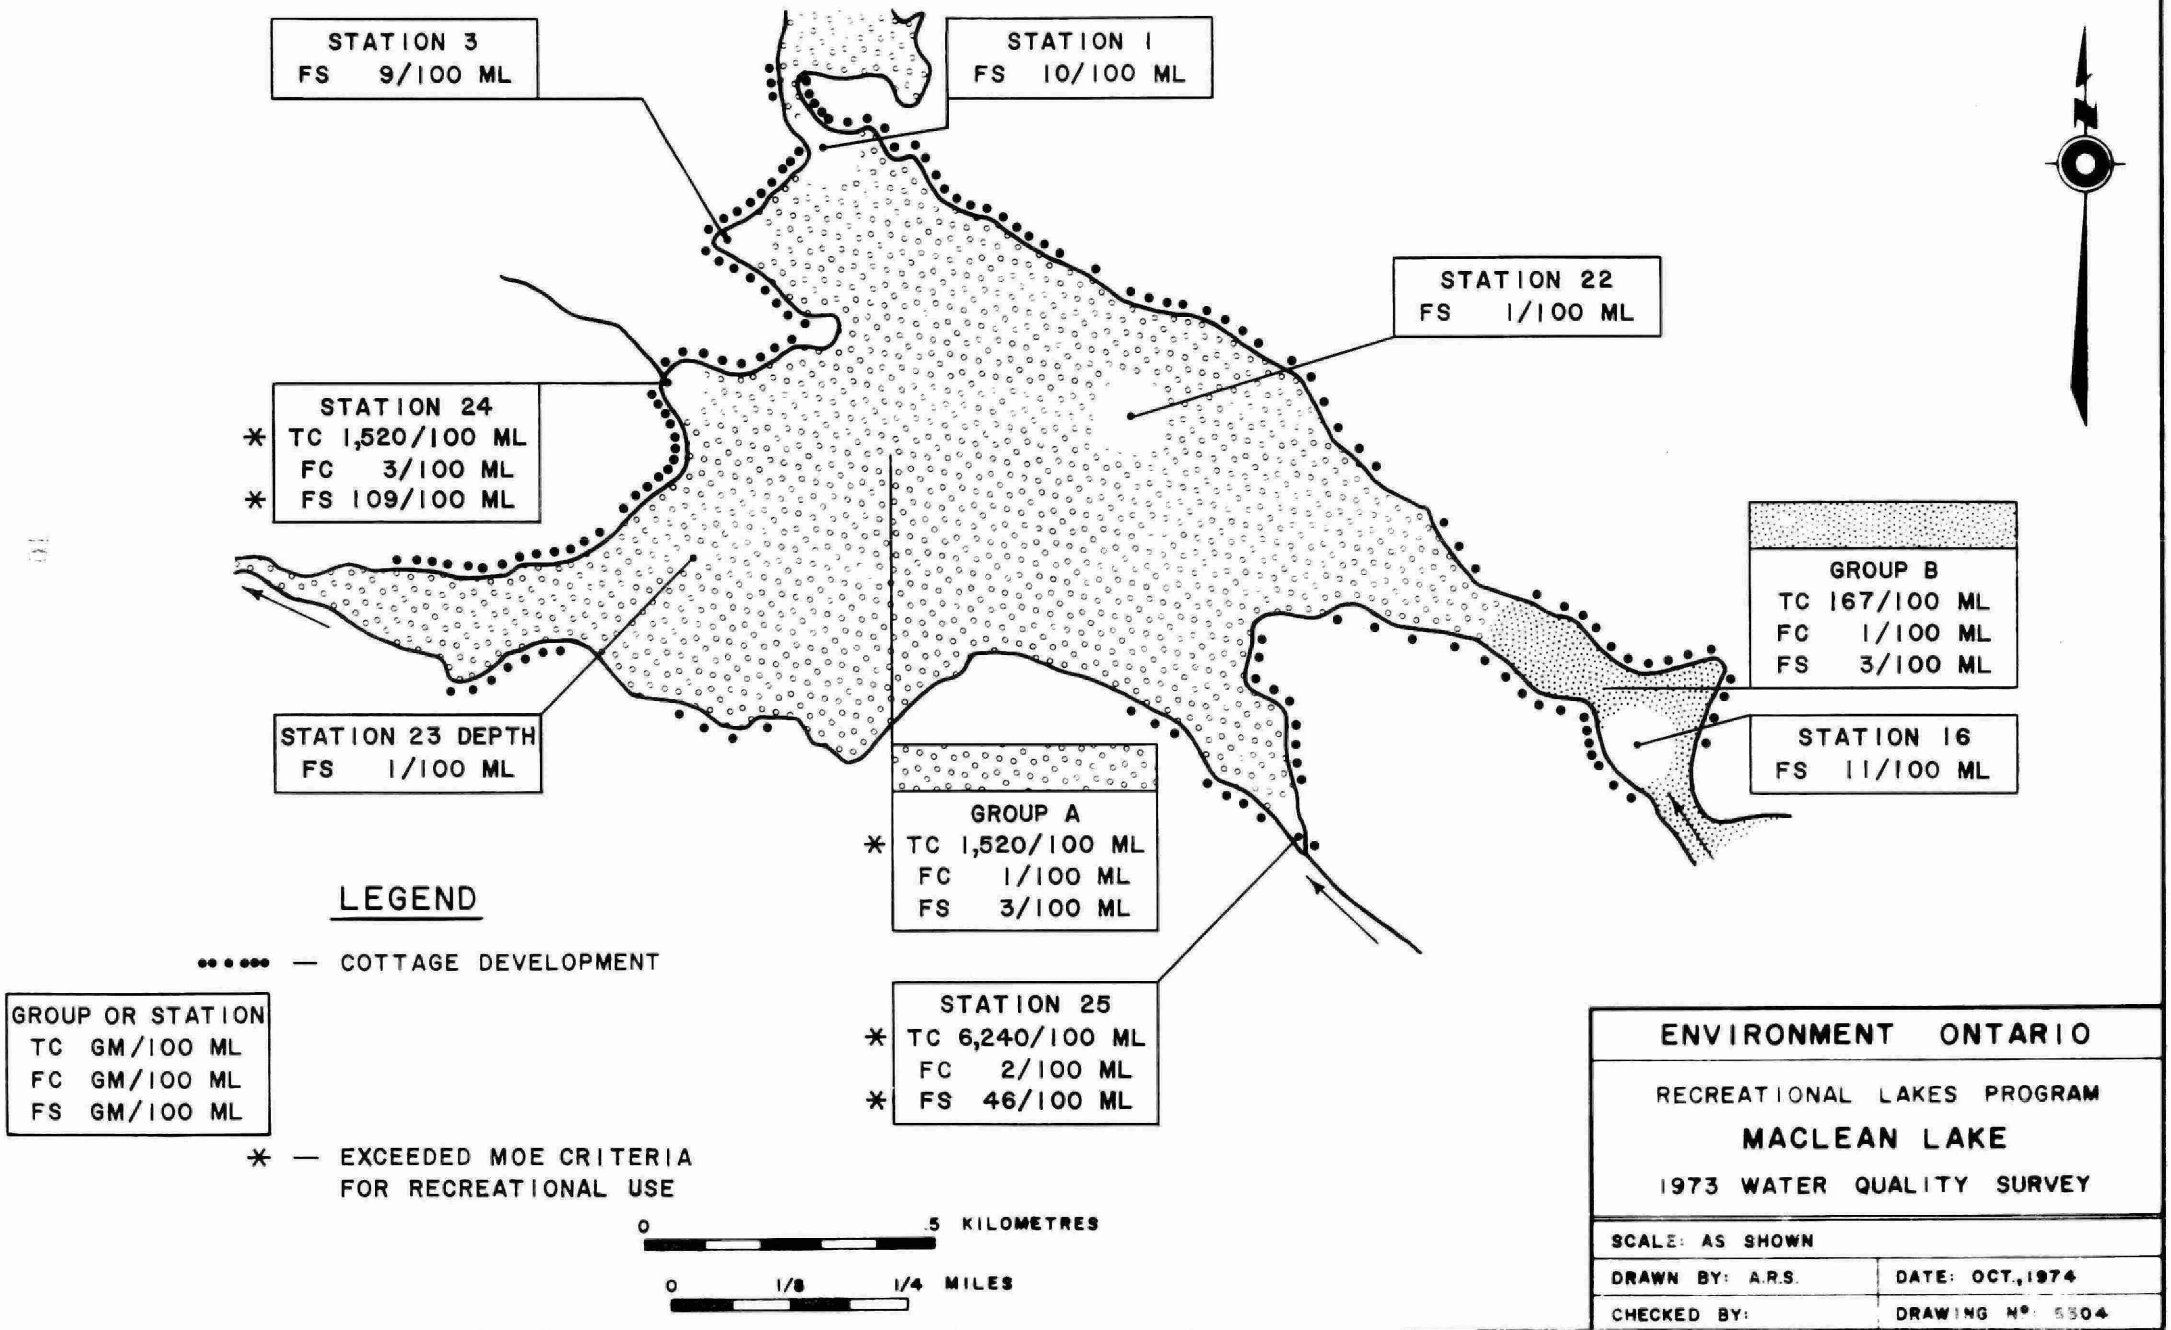


FIGURE 4 - DISTRIBUTION OF BACTERIA DURING THE AUGUST SURVEY

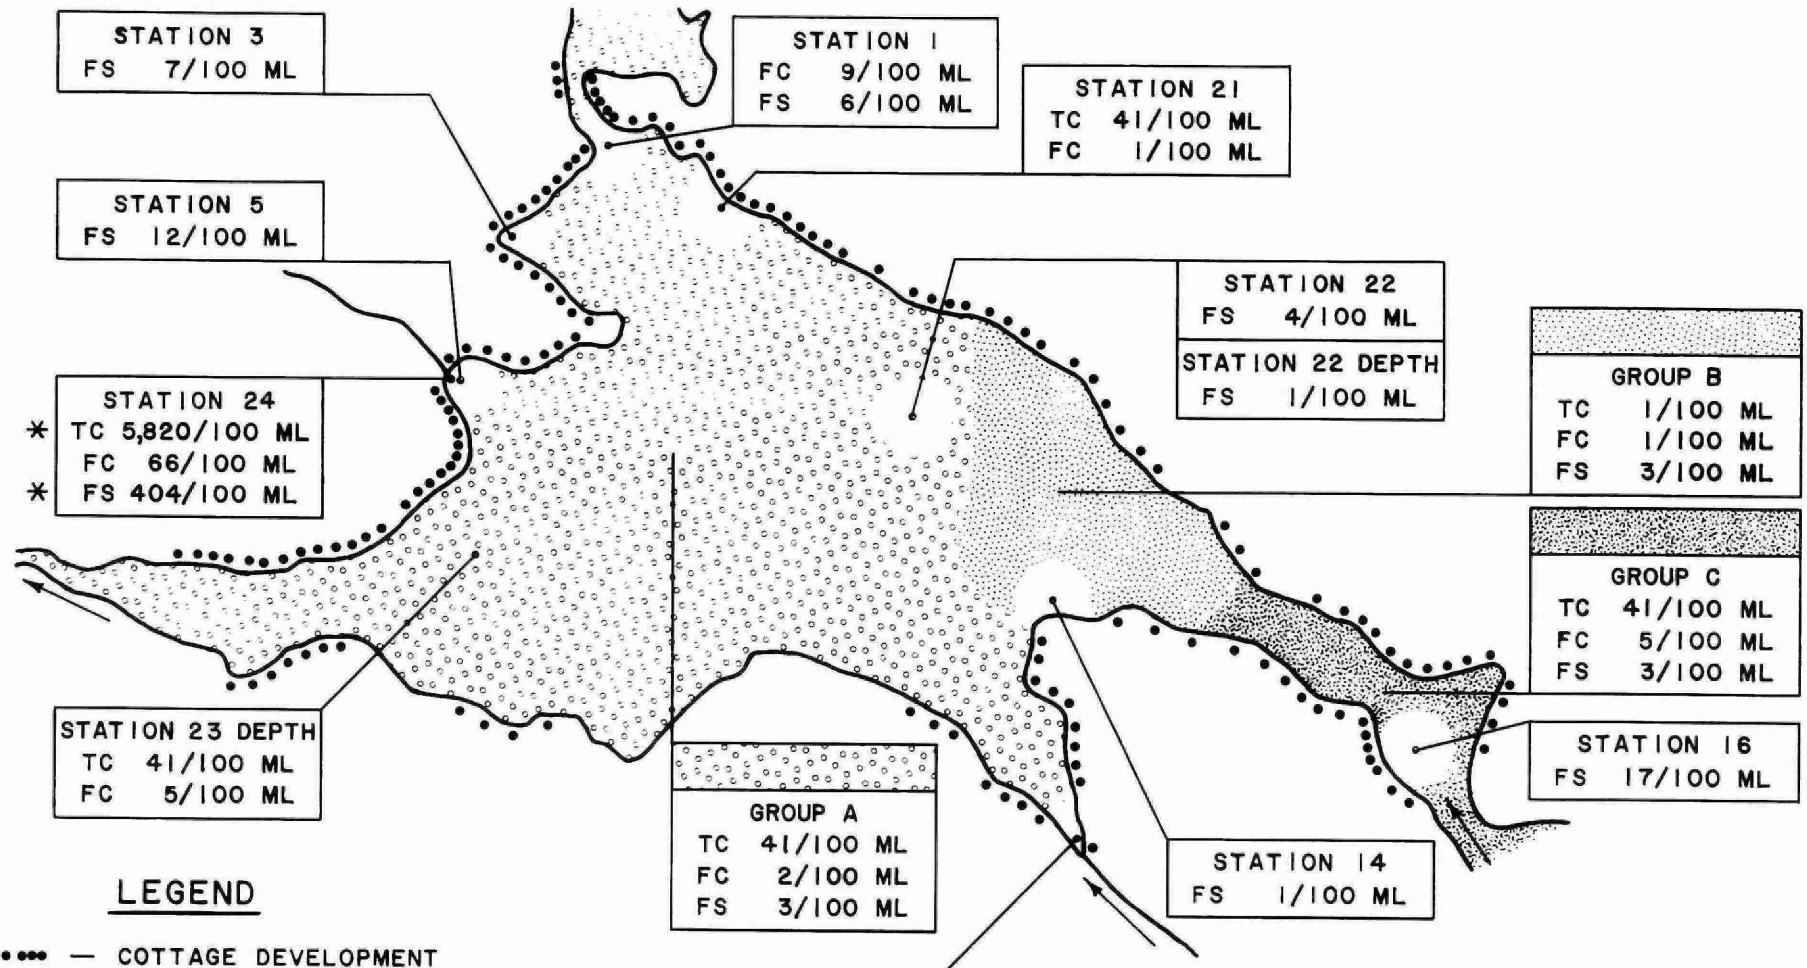

GROUP OR STATION
TC GM/100 ML
FC GM/100 ML
FS GM/100 ML

* — EXCEEDED MOE CRITERIA
FOR RECREATIONAL USE



ENVIRONMENT ONTARIO

RECREATIONAL LAKES PROGRAM

MACLEAN LAKE

1973 WATER QUALITY SURVEY

SCALE: AS SHOWN



DRAWN BY: A.R.S.

DATE: OCT., 1974

CHECKED BY:

DRAWING NO: 5304

FIGURE 5 - DISTRIBUTION OF BACTERIA DURING THE SEPTEMBER SURVEY

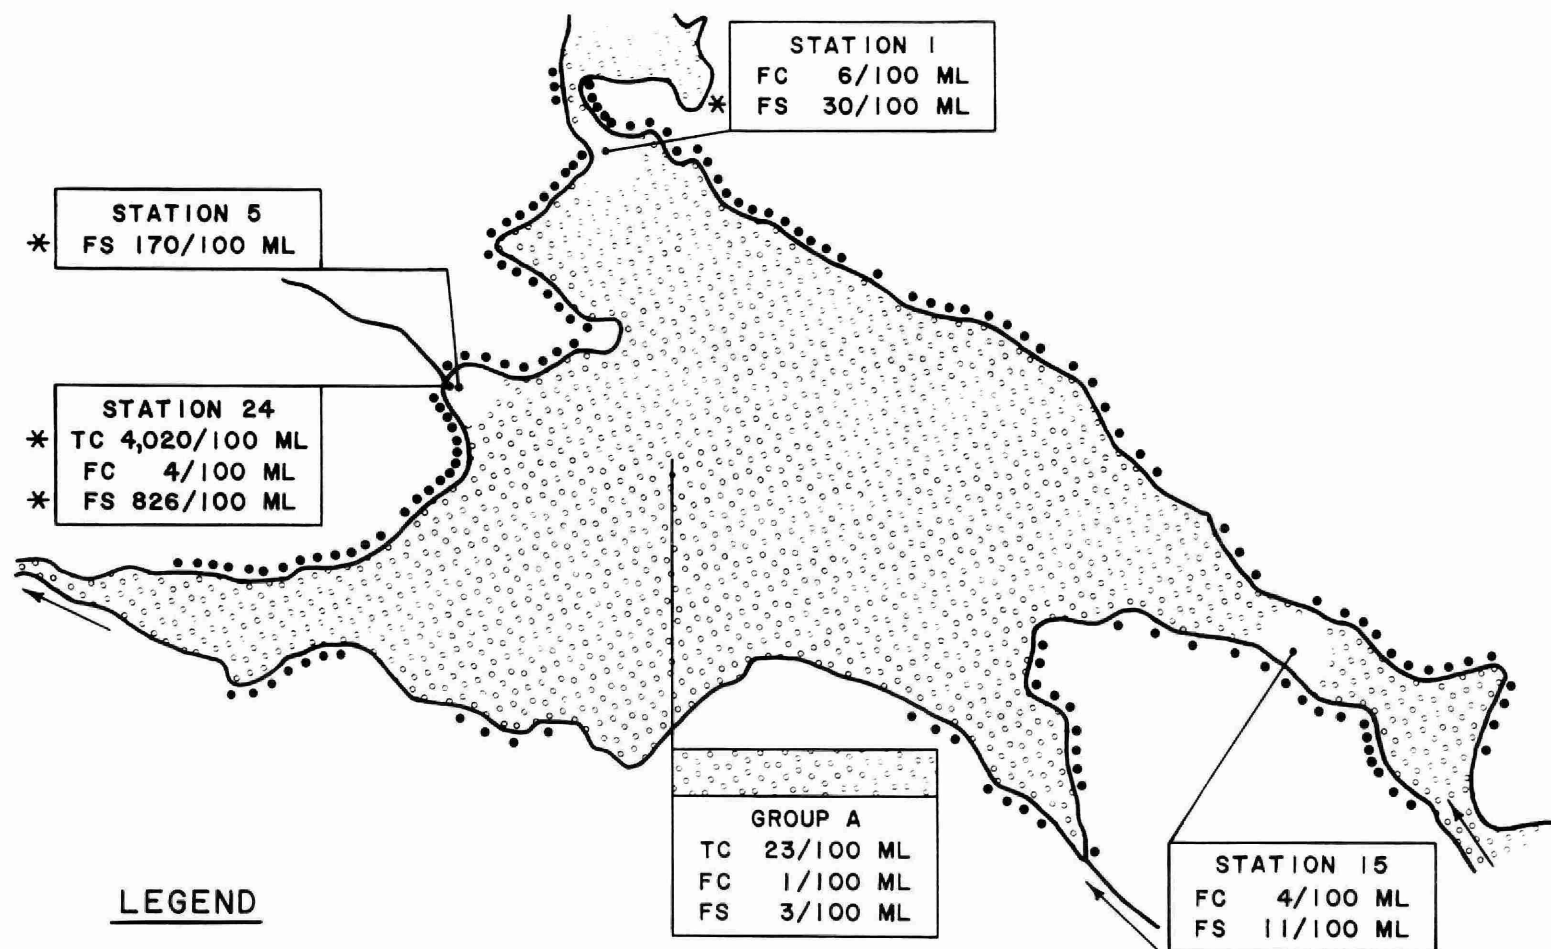

ENVIRONMENT ONTARIO

RECREATIONAL LAKES PROGRAM

MACLEAN LAKE

1973 WATER QUALITY SURVEY

SCALE: AS SHOWN

DRAWN BY: A.R.S.

DATE: OCT., 1974

CHECKED BY:

DRAWING NO: 5304

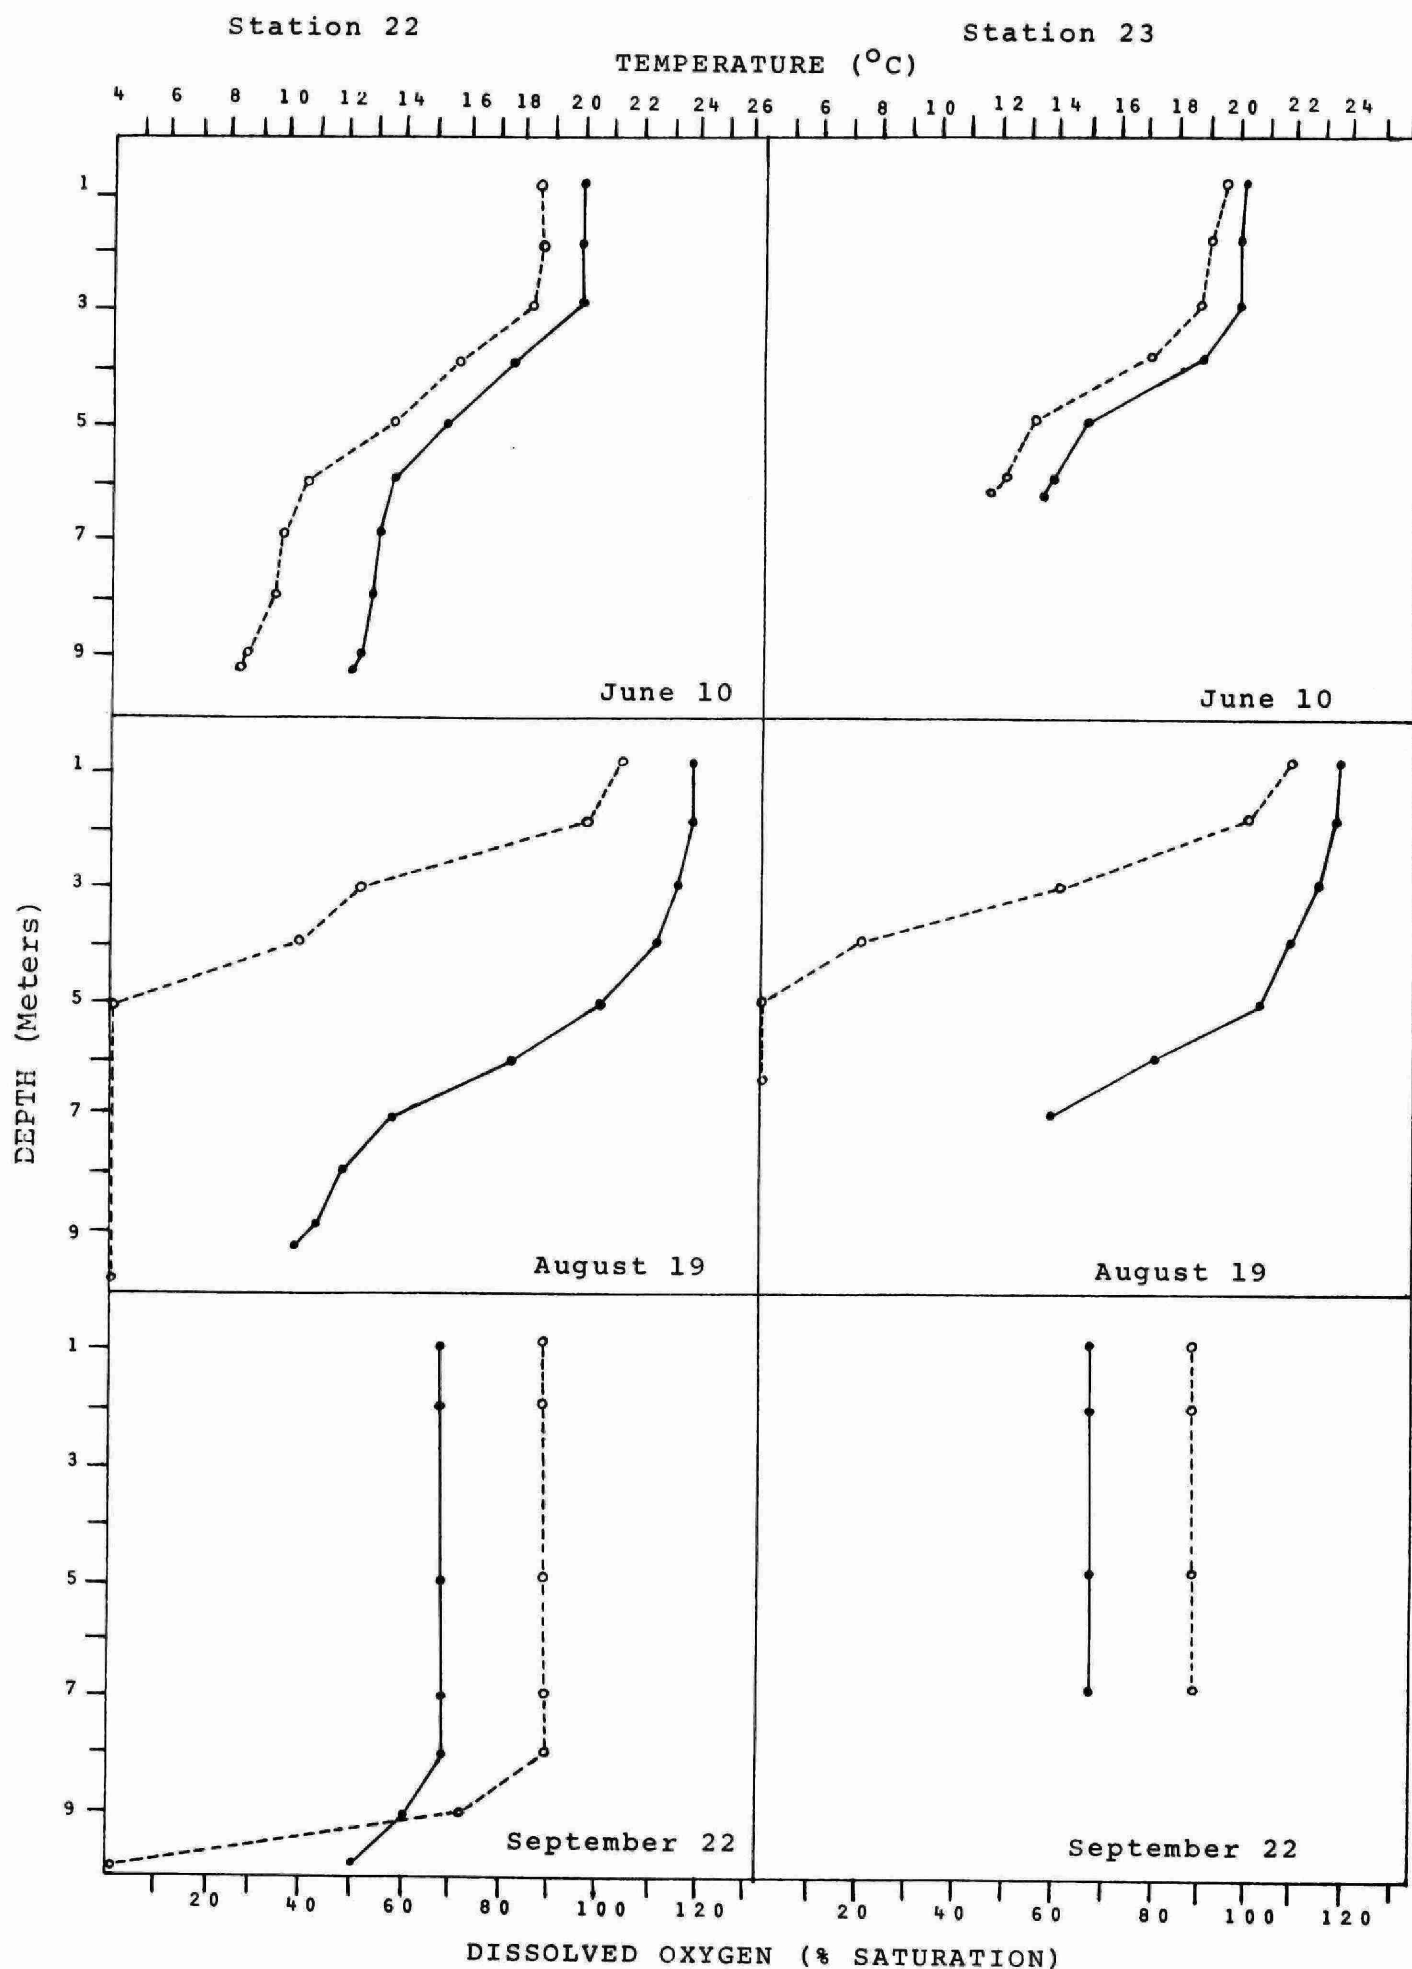


Figure 6 : Dissolved oxygen (---) and temperature (—) profiles at Stations 22 and 23 on MacLean Lake.

MacLean Lake is a soft-water lake having relatively low alkalinity, conductivity, chloride and pH values as indicated in the following table:

Overall Ranges

	Hardness (mg/1 as CaCO ₃)	Alkalinity (mg/1 as CaCO ₃)	Conductivity (umhos/cm ³)	Chloride (mg/1 as Cl)	pH (units)
Stn 22	17-34	16-35	43-68	1-5	5.9-7.4
Stn 23	17-34	15-27	48-76	1-5	6.1-7.7
Inf Stn 1 & 16	15-36	12-28	37-76	1-7	6.0-7.3
Inf Stn 24	32-77	26-59	71-170	1-4	6.6-6.9
Out- flow	19-37	16-35	51-76	1-6	6.6-7.4

The above table does not include inexplicably high results from outflow Station 8 on September 20 and October 17. The pH values at the mid-lake stations were lower in the bottom waters than at the surface. The surface water pH averaged 6.9 at both mid-lake stations, while the bottom waters averages were 6.6 for Stations 22 and 23 respectively.

Although the mineral values were relatively low, the nutrient and iron values in the bottom waters of the mid-lake stations were very high and exhibited seasonal trends which varied with the stations. At Station 22, due to the sustained dissolved oxygen depletions in the bottom waters during the summer and fall surveys, increasing amounts of phosphorus, total Kjeldahl nitrogen and iron were released from the bottom sediments. The extremely high fall values at Station 22 are probably due both to continued regeneration from the bottom sediments and to the accumulation of nutrients in particulate matter settled out from the surface waters. Samples taken at Station 22 in October and November, following mixing of the lake, indicated uniform nutrient and iron concentrations from the surface to the bottom, with bottom concentrations lower than the spring mean values. At Station 23, accumulation of nutrients in these shallower bottom waters was noted during the summer survey, although on a much smaller scale than at Station 22. The phosphorus, total Kjeldahl nitrogen and iron concentrations in the bottom at Station 23 increased from the spring to the summer survey, however, only total Kjeldahl nitrogen concentrations increased in the fall, while phosphorus and iron values decreased (see table below).

	Station 22 (mg/1)				Station 23 (mg/1)		
Bottom Water	Spring	Summer	Fall	Oct. Nov.	Spring	Summer	Fall
Phosphorus	0.055	0.33	0.41	0.029	0.031	0.076	0.034
Total Kjeldahl Nitrogen	0.69	1.2	1.9	0.69	0.53	0.67	0.85
Iron	0.91	5.1	10.1	0.42	0.65	1.7	0.50
<u>Surface Water</u>							
Phosphorus	0.032	0.034	0.036	0.033	0.026	0.040	0.038
Total Kjeldahl Nitrogen	0.54	0.71	0.98	0.71	0.52	0.75	0.75
Iron	0.54	0.49	0.60	0.42	0.36	0.47	0.50

Surface water concentrations of phosphorus, total Kjeldahl nitrogen, and iron at Station 22 increased slightly between each survey (see table above) with phosphorus having the least seasonal variation. The concentrations at Station 23 increased from the spring to the summer survey, but remained constant from the summer to the fall. These surface water nutrient concentrations were high enough to support the heavy algal growths present in the lake.

The major inflows, Stations 1 and 16, had high concentrations of nutrients and iron (see table below) which varied somewhat but showed no seasonal trends and were likely due to natural land runoff and marsh drainage. The mean concentrations at these two inflow locations for the three surveys were high. Concentrations were also high at two other inflows, Stations 24 and 25, however, their input is considered of lesser importance during the summer due to minimal flows.

Overall Means

	Phosphorus (mg/1)	Total Kjeldahl Nitrogen (mg/1)	Iron (mg/1)
Station 1	.050	.83	.50
Station 16	.055	.88	.89

Samples for sodium, potassium and sulphate analyses collected through the illuminated surface waters indicated mean values of 1.5 mg/l, 1.4 mg/l and 7.5 mg/l respectively for both mid-lake stations.

The lake is highly coloured (40-70 Hazen units) as a result of drainage from surrounding marsh soils.

Chlorophyll a and Water Clarity

The mean chlorophyll a concentration on McLean Lake during the ice-free period was 15.5 ug/l and indicates high densities of suspended algae. However, there were significant seasonal trends in concentrations which rose from moderately low in the spring to moderately high in the summer to extremely high in the fall survey. The mean seasonal concentrations of chlorophyll a (as expressed in ug/l) for the mid-lake stations and the two major inflow areas respectively are indicated in the following table:

	Mid-lake Stations		Inflows	
	Station 22	Station 23	Station 1	Station 16
Spring	3.8	3.5	5.7	8.6
Summer	8.5	9.0	6.4	11.6
Fall	50.7	50.0	75.0	28.0

These high fall concentrations substantiated observations of an extensive algal bloom which severely reduced the water quality for recreational activities and diminished the aesthetic quality of the lake. The elevated chlorophyll a values in the inflow areas are indicative of both the high nutrient values and the drainage of extensive still-water areas which are conducive to high production of suspended algae. The water clarity was poor, as indicated by an overall mean Secchi disc reading of 1.9 meters. The poor water clarity can be attributed to the natural water colour in addition to dense algal growths. The Secchi disc reading decreased with each seasonal survey as the chlorophyll a concentrations increased. The Secchi disc mean values for both mid-lake stations were 2.2 meters, 1.8 meters, and 1.3 meters for the spring, summer and fall surveys respectively. Highly enriched lakes exhibit their symptoms of enrichment in several ways (see pA-6 for an explanation of the relationships between nutrient enrichment, lake water clarity and abundance of suspended algae).

A relationship between chlorophyll a and Secchi disc was derived by Ministry of the Environment Staff, and the status of enrichment of MacLean lake, relative to other well-known lakes, is shown in Figure 7 (see also pA-9). MacLean Lake is similar to Scugog Lake, Riley Lake and Gravenhurst Bay, all of which are highly enriched bodies of water.

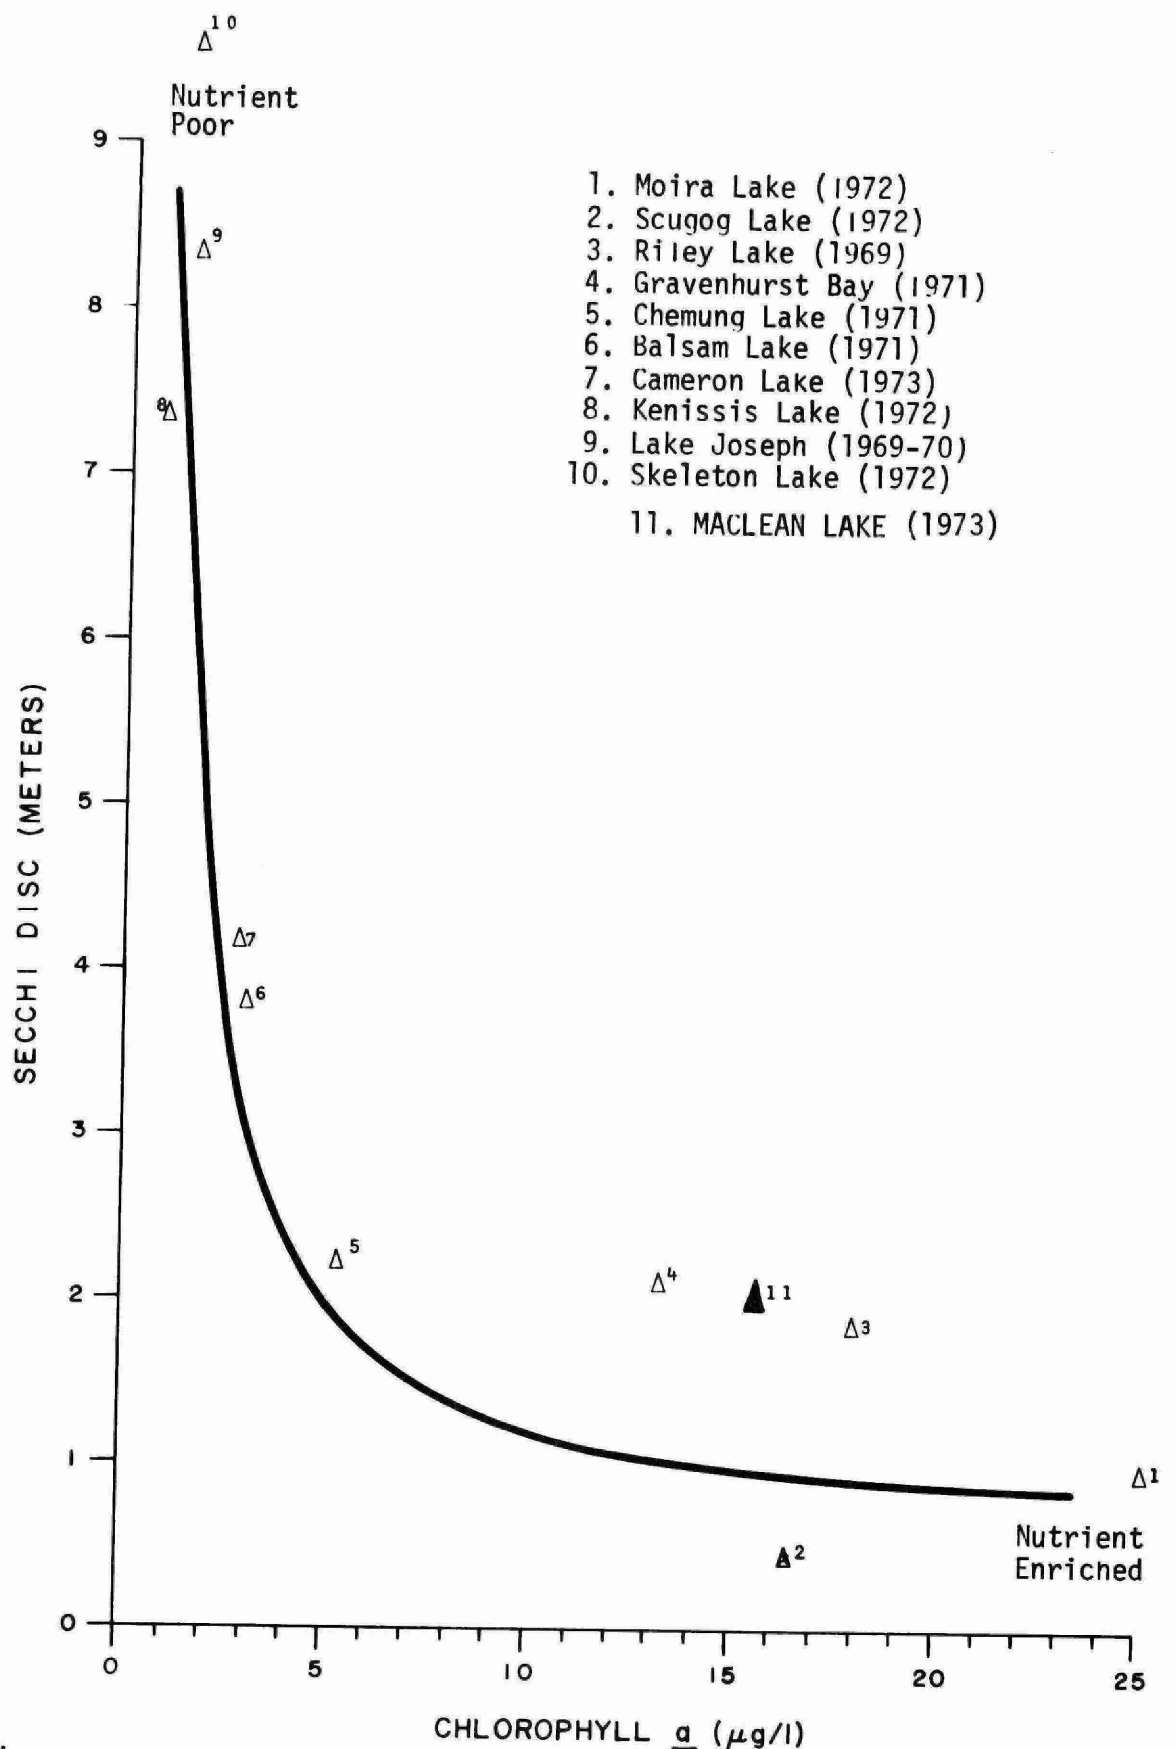


Figure 7 : The mean of chlorophyll *a* and Secchi disc measurements in MacLean Lake relative to a curve describing the chlorophyll *a*-Secchi disc relationship in many Ontario lakes. Ten other well-known lakes are included for comparison with MacLean Lake.

Several features of MacLean Lake are probably combining to produce the unacceptably algae-rich and turbid waters. The enriched conditions resulting from the large amounts of nutrients released from the bottom sediments coupled with the high concentrations in the inflows are likely being aggravated by discharges of nutrients from faulty waste disposal systems on the lake. Owners of the large number of substandard systems detected by the Private Waste and Water Management Branch in 1973 should comply with the remedial measures being recommended by the Simcoe County Health Unit, so that these preventable inputs of bacteria and nutrients can be eliminated.

Aquatic Plants in Shoreline Areas

Aquatic plant growth has reached nuisance proportions in several shallow areas of MacLean Lake, especially in the general areas of Station 8 and 16. Thirteen genera of aquatic weeds, from which ten species were identified, were found in shoreline areas of MacLean Lake. Some of the plants could only be identified to genus because of the lack of fruiting and flowering structure necessary for complete identification (e.g. milfoil). Figure 2 outlines the location and extent of the weed beds and indicates the densities of the weeds found in each area. Cottagers wishing to control plant growth in localized areas adjacent to docks and in front of cottages should refer to page A-9.

Table 1: A list of the aquatic plants found in MacLean Lake and the number of areas in which each plant type occurred. For convenience, the plants are divided into two categories: (a) submergent - aquatic weeds which live, for the most part, underwater and (b) - emergent - aquatic weeds which produce floating or aerial leaves

Scientific Name (genus species)	Common Name (s)	Distribution (number of areas)
(a) <u>SUBMERGENT</u>		
<u>Myriophyllum</u> sp.	milfoil	3
<u>Anacharis canadensis</u>	canada waterweed, elodea	3
<u>Najas flexilis</u>	bushy pondweed	3
<u>Potamogeton richardsonii</u>	richardson's pondweed	1
<u>Chara</u> sp.*	chara, stonewort	1
<u>Potamogeton robbinsii</u>	robbins' pondweed	1
<u>Ceratophyllum demersum</u>	coontail	1
<u>Utricularia</u> sp.	bladderwort	1
<u>Potamogeton natans</u>	floating-leaf pondweed	2
(b) <u>EMERGENT</u>		
<u>Nuphar</u> sp.	yellow waterlily	5
<u>Nymphaea</u> sp.	white waterlily	3
<u>Pontederia cordata</u>	pickerelweed	4
<u>Typha latifolia</u>	cattail	1
<u>Zizania aquatica</u>	wild rice	1

* Chara is technically an alga, but because it grows in long strands it is often classified as an aquatic weed.

FUTURE CONSIDERATIONS

It is important to note that of the 200 disposal systems inspected in 1973 by the Private Waste and Water Management Branch, only 63 were classified as satisfactory. Eleven direct polluters were found in addition to 34 systems which were classified as seriously substandard. The rest had a variety of other objectionable features including systems which were too close to wells, ponding of tile beds and inadequate leaching pits. It is strongly recommended that owners of substandard systems carry out those remedial measures being advised by staff of the Simcoe County Health Unit as soon as possible.

INFORMATION OF GENERAL INTEREST TO COTTAGERS

MICROBIOLOGY OF WATER

For the sake of simplicity, the micro-organisms in water can be divided into two groups: the bacteria that thrive in the lake environment and make up the natural bacterial flora; and the disease causing micro-organisms, called pathogens, that have acquired the capacity to infect human tissues.

The "pathogens" are generally introduced to the aquatic environment by raw or inadequately treated sewage, although a few are found naturally in the soil. The presence of these bacteria does not change the appearance of the water but poses an immediate public health hazard if the water is used for drinking or swimming. The health hazard does not necessarily mean that the water user will contract serious waterborn infections such as typhoid fever, polio or hepatitis, but he may catch less serious infections of gastro-enteritis (sometimes called stomach flu), dysentery or diarrhea. Included in these minor afflictions are eye, ear and throat infections that swimmers encounter every year and the more insidious but seldom diagnosed, sub-clinical infections usually associated with several waterborn viruses. These viral infections leave a person not feeling well enough to enjoy holidaying although not bedridden. This type of microbial pollution can be remedied by preventing wastes from reaching the lake and water quality will return to satisfactory conditions within a relatively short time (approximately one year) since disease causing bacteria usually do not thrive in an aquatic environment.

The rest of the bacteria live and thrive within the lake environment. These organisms are the instruments of biodegradation. Any organic matter in the lake will be used as food by these organisms and will give rise, in turn to subsequent increases in their numbers. Natural organic matter as well as that from sewage, kitchen wastes, oil and gasoline are readily attacked by these lake bacteria. Unfortunately, biodegradation of the organic wastes by organisms uses correspondingly large amounts of the dissolved oxygen. If the organic matter content of the lake gets high enough, these bacteria will deplete the dissolved oxygen supply in the bottom waters and threaten the survival of many deep-water fish species.

RAINFALL AND BACTERIA

The "Rainfall Effect" referred to in the text, relates to a phenomenon that has been documented in previous surveys of the Recreational Lakes. Heavy precipitation has been shown to flush the land area around the lake and the subsequent runoff will carry available contaminants including sewage organisms as well as natural soil bacteria with it into the water.

Total coliforms, fecal coliforms and fecal streptococci, as well as other bacteria and viruses which inhabit human waste disposal systems, can be washed into the lake. In Precambrian areas where there is inadequate soil cover and in

fractured limestone areas where fissures in the rocks provide access to the lake, this phenomenon is particularly evident.

Melting snow provides the same transportation function for bacteria, especially in an agricultural area where manure spreading is carried out in the winter on top of the snow.

Previous data from sampling points situated 50 to 100 feet from shore indicate that contamination from shore generally shows up within 12 to 48 hours after a heavy rainfall.

WATER TREATMENT

Lake and river water is open to contamination by man, animals and birds (all of which can be carriers of disease); consequently, NO SURFACE WATER MAY BE CONSIDERED SAFE FOR HUMAN CONSUMPTION without prior treatment, including disinfection. Disinfection is especially critical if coliforms have been shown to be present.

Disinfection can be achieved by:

(a) Boiling

Boil the water for a minimum of five minutes to destroy the disease causing organisms.

(b) Chlorination using a household bleach containing 4 to 5½ percent available chlorine.

Eight drops of a household bleach solution should be mixed with one gallon of water and allowed to stand for 15 minutes before drinking.

(c) Continuous Chlorination

For continuous water disinfection, a small domestic hypochlorinator (sometimes coupled with activated charcoal filters) can be obtained from a local plumber or water equipment supplier.

(d) Well Water Treatment

Well water can be disinfected using a household bleach (assuming strength at 5 percent available chlorine) if the depth of water and diameter of the well are known.

CHLORINE BLEACH
Per 10 ft. Depth of Water

Diameter of Well Casing in Inches	One to Ten Coliforms	More Than Ten Coliforms
4	0.5 oz.	1 oz.
6	1 oz.	2 oz.
8	2 oz.	4 oz.
12	4 oz.	8 oz.
16	7 oz.	14 oz.
20	11 oz.	22 oz.
24	16 oz.	31 oz.
30	25 oz.	49 oz.
36	35 oz.	70 oz.

Allow about six hours of contact time before using the water.

Another bacteriological sample should be taken after one week of use.

Water Sources (spring, lake, well, etc.) should be inspected for possible contamination routes (surface soil, runoff following rain and seepage from domestic waste disposal sites). Attempts at disinfecting the water alone without removing the source of contamination will not supply bacteriologically safe water on a continuing basis.

There are several types of low cost filters (ceramic, paper, carbon, diatomaceous earth sometimes impregnated with silver, etc.) that can be easily installed on taps or in water lines. These may be useful to remove particles, if water is periodically turbid, and are usually very successful. Filters, however, do not disinfect water but may reduce bacterial numbers. For safety, chlorination of filtered water is recommended.

SEPTIC TANK INSTALLATIONS

In Ontario, provincial law requires under Part 7 of the Environment Protection Act that before you extend, alter, enlarge or establish any building where a sewage system will be used, a Certificate of Approval must be obtained from the Ministry of the Environment or its representatives. The local municipality or Health Unit may be delegated the authority to issue the Certificate of Approval. Any other pertinent information such as size, types and location of septic tanks and tile fields can also be obtained from the same authority.

(1) General Guidelines

A septic tank should not be closer than:

-50 feet to any well, lake, stream, pond, spring, river or reservoir

- 5 feet to any building
- 10 feet to any property boundary

The tile field should not be closer than:

- 100 feet to the nearest dug well
- 50 feet to a drilled well which has a casing to 25 feet below ground
- 25 feet to a building with a basement that has a floor below the level of the tile in the tile bed
- 10 feet to any other building
- 10 feet to a property boundary
- 50 feet to any lake, stream, pond, spring, river or reservoir

The ideal location for a tile field is in a well-drained, sandy loam soil remote from any wells or other drinking water sources. For the tile field to work satisfactorily, there should be at least 3 feet of soil between the bottom of the weeping tile trenches and the top of the groundwater table or bedrock.

Recognizing that private sewage systems are relatively inefficient where shallow and inappropriate soil conditions are present (e.g. Precambrian areas) the Ministry of the Environment is conducting research into alternate methods of private sewage disposal in unsewered areas; into the improvement of existing equipment and methods of design and operation for these systems; and into the development of better surveillance methods such as by the use of chemical, biological and radioactive tracers to detect the movement of pollutants through the soil mantle.

DYE TESTING OF SEPTIC TANK SYSTEMS

There is considerable interest among cottage owners to dye test their sewage systems; however, several problems are associated with dye testing. Dye would not be visible to the eye from a system that has a fairly direct connection to the lake. Thus, if a cottager dye-tested his system and no dye was visible in the lake, he would assume that his system is satisfactory, which might not be the case. A low concentration of dye is not visible and therefore expensive equipment such as a fluorometer is required. Only qualified people with adequate equipment are capable of assessing a sewage system by using dye. In any case, it is likely that some of the water from a septic tank will eventually reach the lake. The important question is whether all contaminants including nutrients have been removed before it reaches the lake. To answer this question special knowledge of the system, soil depth and composition, underground geology of the region and the shape and flow of the shifting water table are required. Therefore, we recommend that this type of study should be performed only by qualified professionals.

BOATING AND MARINA REGULATIONS

In order to help protect the lakes and rivers of Ontario from pollution, it is required by law that sewage (including garbage) from all pleasure craft, including houseboats, must be retained in suitable equipment. Equipment which is considered suitable by the Ministry of the Environment includes (1) retention devices with or without re-circulation which retain all toilet wastes for disposal ashore, and (2) incinerating devices which reduce all sewage to ash.

Equipment for storage of toilet wastes shall:

1. be non-portable
2. be constructed of structurally sound material
3. have adequate capacity for expected use
4. be properly installed, and
5. be equipped with the necessary pipes and fittings conveniently located for pump-out by shore-based facilities (although not specified, a pump-out deck fitting with 1½-inch diameter National Pipe Thread is commonly used).

An Ontario regulation requires that marinas and yacht clubs provide or arrange pump-out service for the customers and members who have toilet-equipped boats. In addition, all marinas and yacht clubs must provide litter containers that can be conveniently used by occupants of pleasure boats.

The following "Tips" may be of assistance to you in boating:


1. Motors should be in good mechanical condition and properly tuned.
2. When a tank for outboard motor testing is used, the contents should not be emptied into the water.
3. If the bilge is cleaned, the waste material must not be dumped into the water.
4. Fuel tanks must not be overfilled and space must be left for expansion if the fuel warms up.
5. Vent pipes should not be obstructed and fuel needs to be dispensed at a correct rate to prevent "blow-back".
6. Empty oil cans must be deposited in a leak-proof receptacle, and,
7. Slow down and save fuel.

EUTROPHICATION OR EXCESSIVE FERTILIZATION AND LAKE PROCESSES

In recent years, cottagers have become aware of the problems associated with nutrient enrichment of recreational lakes and have learned to recognize many of the symptoms characterizing nutrient enriched (eutrophic) lakes. It is important to realize that small to moderate amounts of aquatic plants and algae are necessary to maintain a balanced aquatic environment. They provide food and a suitable environment for the growth of aquatic invertebrate organisms which serve as food for fish. Shade from large aquatic plants helps to keep the lower water cool, which is essential to certain species of fish and also provides protection for young game and forage fish. Numerous aquatic plants are utilized for food and/or protection by many species of waterfowl. However, too much growth creates an imbalance in the natural plant and animal community particularly with respect to oxygen conditions, and some desirable forms of life such as sport fish are eliminated and unsightly algae scums can form. The lake will not be "dead" but rather abound with life which unfortunately is not considered aesthetically pleasing. This change to poor water quality becomes apparent after a period of years during which extra nutrients are added to the lake and return to the natural state may also take a number of years after the nutrient inputs are stopped.


Changes in water quality with depth are a very important characteristic of the lake. Water temperatures are uniform throughout the lake in the early spring and winds generally keep the entire volume well mixed. Shallow lakes may remain well mixed all summer so that water quality will be the same throughout. On the other hand, in deep lakes, the surface waters warm up during late spring and early summer and float on the cooler more dense water below. The difference in density offers a resistance to mixing by wind action and many lakes do not become fully mixed again until the surface waters cool down in the fall. The bottom water receives no oxygen from the atmosphere during this unmixed period and the dissolved oxygen supply may be all used up by bacteria as they decompose organic matter. Cold water fish, such as trout, will have to move to the warm surface waters to get oxygen and because of the high water temperatures they will not thrive, so that the species will probably die out (see Figure next page).

Low oxygen conditions in the bottom waters are not necessarily an indication of pollution but excessive aquatic plant and algae growth and subsequent decomposition in the bottom waters can aggravate the condition and in some cases result in zero oxygen levels in lakes which had previously held some oxygen in the bottom waters all summer. Although plant nutrients normally accumulate in the bottom waters of the lakes, they do so to a much greater extent if there is no oxygen present. These nutrients become available for algae in the surface waters when the lake mixes in the fall and dense algae growths can result.

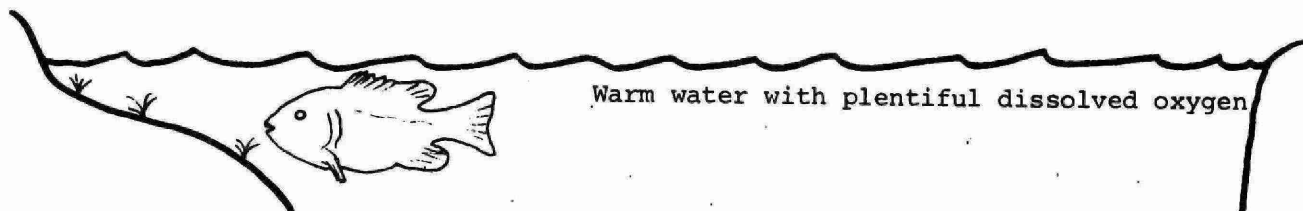

Surface water and shallows are normally inhabited by warm-water fish such as bass, pike and sunfish.

Bottom waters containing plentiful dissolved oxygen are normally inhabited by cold water species such as lake trout and whitefish.

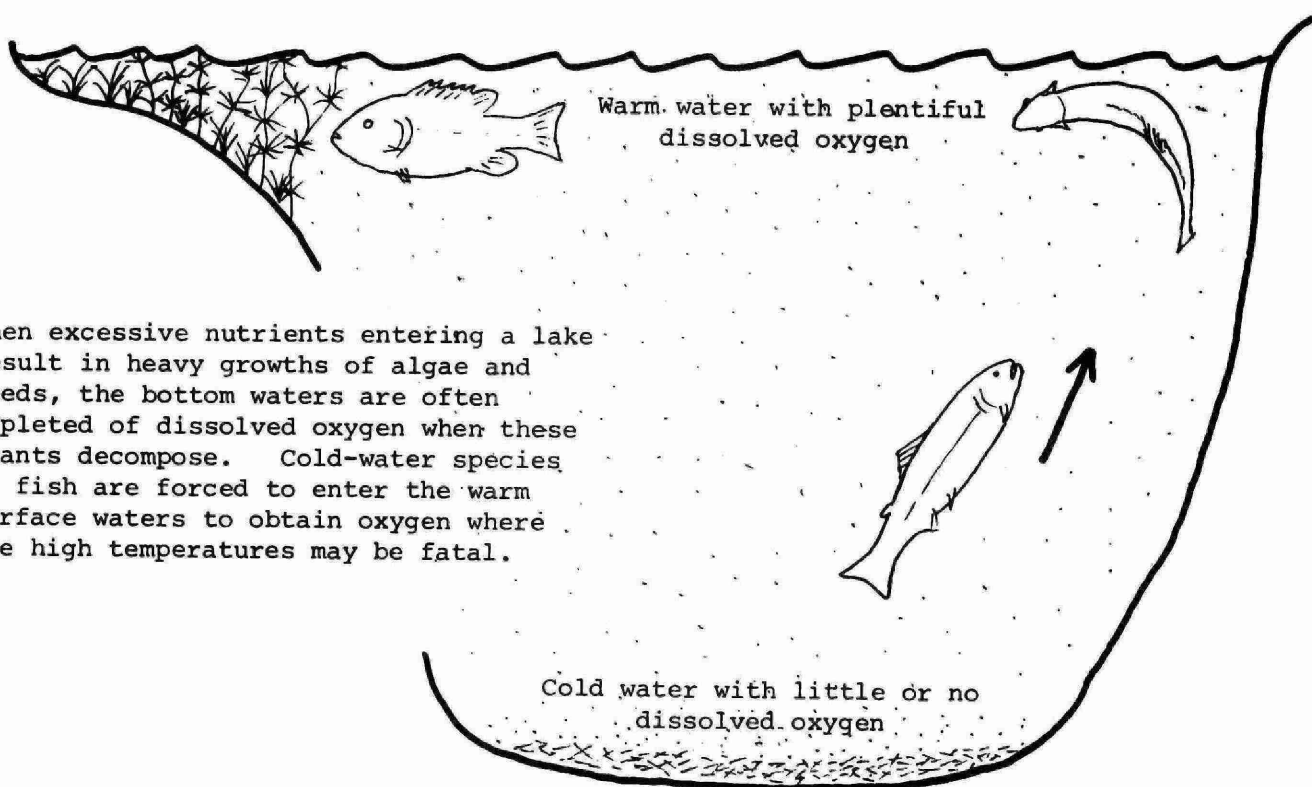

When excessive nutrients entering a lake result in heavy growths of algae and weeds, the bottom waters are often depleted of dissolved oxygen when these plants decompose. Cold-water species of fish are forced to enter the warm surface waters to obtain oxygen where the high temperatures may be fatal.


FIGURE A-1: DECOMPOSITION OF PLANT MATTER AT THE LAKE BOTTOM CAN LEAD TO DEATH OF DEEP-WATER FISH SPECIES.

Consequently, lakes which have no oxygen in the bottom water during the summer are more prone to having algae problems and are more vulnerable to nutrient inputs than lakes which retain some oxygen.

Like humans, aquatic plants and algae require a balanced "diet" for growth. Other special requirements including those for light and temperature are specific for certain algae and plants. Chemical elements such as nitrogen, phosphorus, carbon, and several others are required and must be in forms which are available for uptake by plants and algae. Growth of algae can be limited by a scarcity of any single "critical" nutrient. Nitrogen and phosphorus are usually considered "critical" nutrients because they are most often in scarce supply in natural waters, particularly in lakes in the Precambrian area of the province. Phosphorus, especially is necessary for the processes of photosynthesis and cell division. Nitrogen and phosphorus are generally required in the nitrate-N (or ammonia-N) and phosphate forms and are present in natural land runoff and precipitation. Human and livestock wastes are a very significant source of these and other nutrients for lakes in urban and agricultural areas. It is extremely important that cottage waste disposal systems function so that seepage of nutrients to the lake does not occur since the changes in water quality brought about by excessive inputs of nutrients to lakes are usually evidenced by excessive growths of algae and aquatic plants.

The large amounts of suspended algae which materialize from excessive inputs of nutrients, result in turbid water of poor clarity or transparency. On the other hand, lakes with only small, natural inputs of nutrients and correspondingly low nutrient concentrations (characteristically large and deep lakes) most often support very small amounts of suspended algae and consequently, are clear-water lakes. An indication of the degree of enrichment of lakes can therefore be gained by measuring the density of suspended algae (as indicated by the chlorophyll a concentration - the green pigment in most plants and algae) and water clarity (measured with a Secchi disc). In this regard, staff of the Ministry of the Environment have been collecting chlorophyll a and water clarity data from several lakes in Ontario and have developed a graphical relationship between these parameters which is being used by cottagers to further their understanding of the processes and consequences of nutrient enrichment of Precambrian lakes. The figure on the next page illustrates the above-mentioned relationship.

In the absence of excessive coloured matter (eg. drainage from marshlands), lakes which are very low in nutrients are generally characterized by small amounts of suspended algae (i.e. chlorophyll a) and are clear-water lakes with high Secchi disc values. Such lakes, with chlorophyll a and Secchi disc values lying in the upper left-hand area of the graph are unenriched or nutrient poor ("oligotrophic") in status and do not suffer from the problems associated with excessive inputs of nutrients. In contrast, lakes with high chlorophyll a concentrations and poor clarity are positioned in the lower right-hand area of the graph and are enriched ("eutrophic"). These lakes usually exhibit symptoms of excessive nutrient enrichment including water turbidity owing to large amounts of suspended algae which may float to the surface and accumulate in sheltered areas around docks and bays.

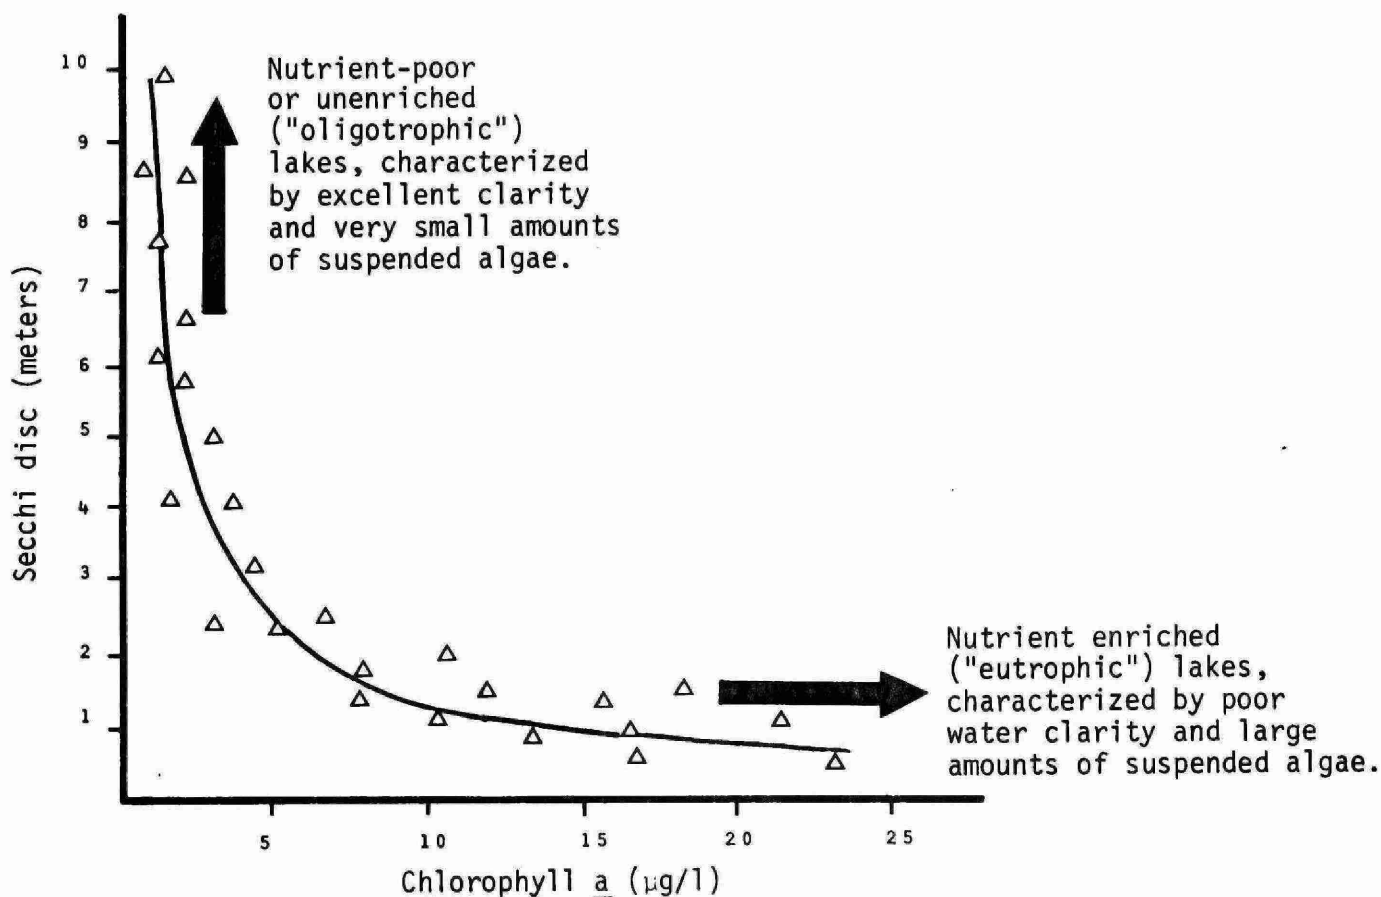

Measurements of suspended algal density (chlorophyll *a*) and water clarity are especially valuable if carried out over several years. Year to year positional changes on the graph can then be assessed to determine whether or not changes in lake water quality are materializing so that remedial measures can be implemented before conditions become critical.

CONTROL OF AQUATIC PLANTS AND ALGAE

Usually aquatic weed growths are heaviest in shallow shoreline areas where adequate light and nutrient conditions prevail.

Extensive aquatic plant and algal growths sometimes interfere with boating and swimming and ultimately diminish shoreline property values.

Control of aquatic plants may be achieved by either chemical or mechanical means. Chemical methods of control are currently the most practical, considering the ease with which they are applied. However, the herbicides and algicides currently available generally provide control for only a single season. It is important to ensure that an algicide or herbicide which kills the plants causing the nuisance, does not affect fish or other aquatic plants. Chemical control in the province is regulated by the Ministry of the Environment and a permit must be granted prior to any operation. Simpleraking and chain dragging operations to control submergent species have been successfully employed in a number of situations; however, the plants soon re-establish themselves. Removal of weeds by underwater mowing techniques is certainly the most attractive method of control and is currently being evaluated in Chemung Lake near Peterborough. Guidelines and summaries of control methods, and applications for permits are available from the Pesticides Control Section, Pollution Control Branch, Ministry of the Environment, 135 St. Clair Avenue West, Toronto, Ontario M4V 1P5.

PHOSPHORUS AND DETERGENTS

Scientists have recognized that phosphorus is the key nutrient in stimulating algal growth in lakes and streams.

In past years, approximately 50 percent of the phosphorus contributed by municipal sewage was added by detergents. Federal regulations reduced the phosphate content (as P_2O_5) in laundry detergents from approximately 50 percent to 20 percent on August 1, 1970 and to 5 percent on January 1, 1973.

It should be recognized that automatic dishwashing compounds were not subject to the government regulations and that surprisingly high numbers of automatic dishwashers are present in resort areas (a questionnaire indicated that about 30 percent of the cottages in the Muskoka lakes have automatic dishwashers). Cottagers utilizing such conveniences may be contributing significant amounts of phosphorus to recreational lakes because automatic dishwashing compounds are characteristically high in phosphorus. Indeed, in most of Ontario's vacation land, the source of domestic water is soft enough to allow the exclusive use of liquid dishwashing compounds, soap and soap-flakes which are, in general, relatively low in phosphorus.

ONTARIO'S PHOSPHORUS REMOVAL PROGRAMME

By 1975, the Government of Ontario expects to have controls in operation at more than 200 municipal wastewater treatment plants across the province serving some 4.7 million persons. This represents about 90 percent of the population serviced by sewers. The programme is in response to the International Joint Commission recommendations as embodied in the Great Lakes Water Quality Agreement and studies carried out by the Ministry of the Environment on inland recreational waters which showed phosphorus to be a major factor influencing eutrophication. Specifically, the programme makes provision for nutrient control in the Upper and Lower Great Lakes, the Ottawa River system and in prime recreational waters where the need is demonstrated or where emphasis is placed upon prevention of localized, accelerated eutrophication.

Phosphorus removal facilities became operational at wastewater treatment plants on December 31, 1973, in the most critically affected areas of the province, including all the plants in the Lake Erie drainage basin and the inland recreational areas. The operational date for plants discharging to waters deemed to be in less critical condition, which includes plants larger than one million gallons per day (1 mgd) discharging to Lake Ontario and to the Ottawa River system, is December 31, 1975. The 1973 phase of the programme involved 113 plants, of which 48 are in prime recreational areas. An additional 53 new plants, each with phosphorus removal, are now under development, 23 of which are located in recreational areas. The capacities of these plants range from 0.04 to 24.0 mgd, serving an estimated population of 1,600,000 persons.

The 1975 phase will bring into operation another 54 plants ranging in size from 0.3 to 180 mgd serving an additional 3,100,00 persons. Treatment facilities utilizing the Lower Great Lakes must meet effluent guidelines of less than 1.0 milligram per litre of total phosphorus in their final effluent. Facilities utilizing the Upper Great Lakes, the Ottawa River Basin and certain areas of Georgian Bay where needs have been demonstrated must remove at least 80 percent of the phosphorus reaching their sewage treatment plants.

CONTROL OF BITING INSECTS

Mosquitoes and blackflies often interfere with the enjoyment of recreational facilities at the lake-side vacation property. Pesticidal spraying or fogging in the vicinity of cottages produces extremely temporary benefits and usually do not justify the hazard involved in contaminating the nearby water. Eradication of biting fly populations is not possible under any circumstances and significant control is rarely achieved in the absence of large-scale abatement programs involving substantial funds and trained personnel. Limited use of approved larvicides in small areas of swamp or in rain pools close to residences on private property may be undertaken by individual landowners, but permits are necessary wherever treated waters may contaminate adjacent streams or lakes. The use of repellents and light traps is encouraged as are attempts to reduce mosquito larval habitat by improving land drainage. Applications for permits to apply insecticides as well as technical advice can be obtained from the Ministry of the Environment, Pesticides Control Service, 3rd Floor, 1 St. Clair Avenue West, Toronto, Ontario.